

# **Nuclear Safety Basics**

Introduction to the goals and terminology of Nuclear Safety

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

# Nuclear Power Generation

Introduction to Nuclear Energy and Nuclear Power Plants

### Nuclear Power — Is it even necessary?


Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

- Fossil fuel power plants
  - burn carbon fuels such coal, oil or gas to generate steam driving large turbines that produce electricity
  - non-renewable fuel: oil depletes soon, gas next, carbon later
  - they produce large amounts carbon dioxide, which causes climate change
  - they increase background radiation
- Large hydro power plants
  - water from the dams flows through turbines to generate electricity
  - no greenhouse gas emissions
  - impact on the ecology around the dam
  - the number of sites suitable for new dams is limited
- Other renewables
  - wind, solar and small scale hydro produce electricity with no greenhouse gas emissions
  - higher cost than other forms of generation, often requiring subsidies
  - they do not produce electricity predictably or consistently
  - they have to be backed up by other forms of electricity generation



### The Two Sources of Nuclear Energy Production

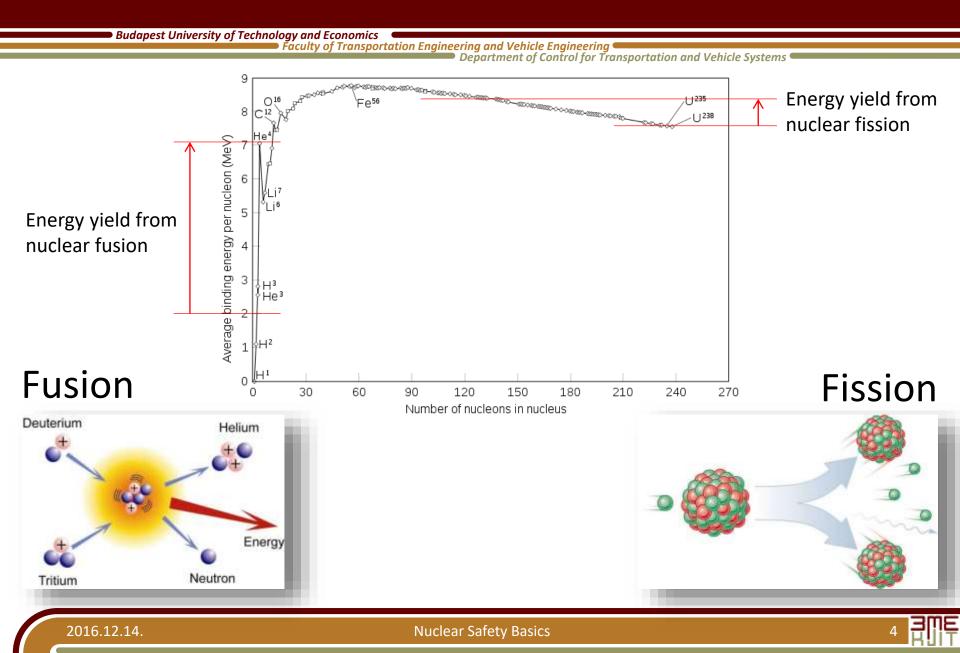

## Comparison of Fission and Fusion

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

	Fission	Fusion	
Mechanism	splitting of a large atom into two or more smaller ones	fusing of two or more lighter atoms into a larger one	
		high density, high temperature (plasma), precise control	
Energy produced	ergy produced much greater than conventional 3 or 4 times greater		
Byproducts	highly radioactive isotopes, long decay time, large residual heat	some helium and tritium (short half- life, very low decay energy)	
Nuclear waste	byproducts, structural materials	structural materials (lower half-life)	
Fuel         235U (0.72%), 232Th, possibly 238U         2H		<sup>2</sup> H (deuterium) and <sup>3</sup> H (tritium)	
Advantages	no greenhouse emissions, economical, highly concentrated fuel, intrinsically safe	no greenhouse emissions, very low amount of waste, abundant fuel, intrinsically safe, low risk	
Disadvantages	high risk, radioactive waste	commercial application is far away	



## Controllability of Nuclear Fission

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

- Effective neutron multiplication factor (k) is the average number of neutrons from one fission to cause another fission
  - k < 1 (subcriticality): the system cannot sustain a chain reaction
  - k = 1 (criticality): every fission causes an average of one more fission, leading to a constant fission (and power) level
  - k > 1 (supercriticality): the number of fission reactions increases exponentially
- Delayed neutrons are created by the radioactive decay of some of the fission fragments
  - The fraction of delayed neutrons is called  $\boldsymbol{\beta}$
  - Typically less than 1% of all the neutrons in the chain reaction are delayed
- 1 ≤ k < 1/(1-β) is the delayed criticality region, where all nuclear power reactors operate

235

### Inherent Safety of Nuclear Power Plants

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering


- Reactivity is an expression of the departure from criticality:  $\rho = (k 1)/k$ 
  - when the reactor is critical,  $\rho = 0$
  - when the reactor is subcritical,  $\rho < 0$
- The temperature coefficient (of reactivity) is a measure of the change in reactivity (resulting in a change in power) by a change in temperature of the reactor components or the reactor coolant
- The void coefficient (of reactivity) is a measure of the change in reactivity as voids (typically steam bubbles) form in the reactor moderator or coolant
- Most existing nuclear reactors have negative temperature and void coefficients in all states of operation



### (A Few) Types of Nuclear Reactors

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

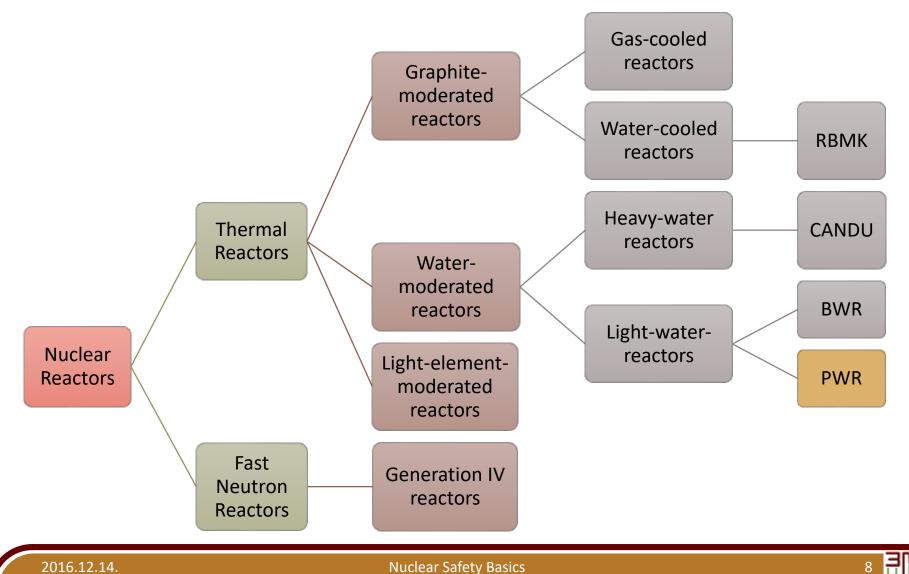


### **Typical Reactor Structures**

Budapest University of Technology and Economics


Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems


#### Typical Pressurized Light-Water Reactor (PWR)

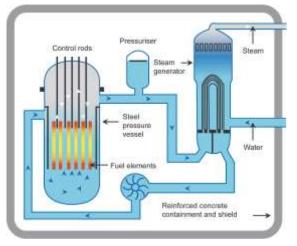


Typical Pressurized Heavy-Water Reactor (PHWR, CANDU)

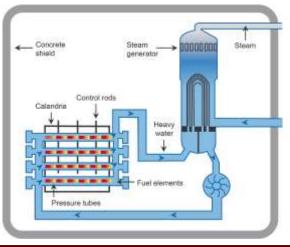

#### Typical Boiling Light-Water Reactor (BWR)

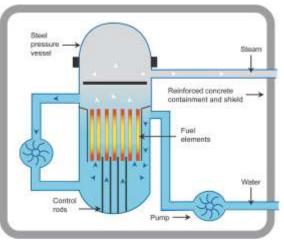

#### Advanced Gas-Cooled Reactor (AGR)

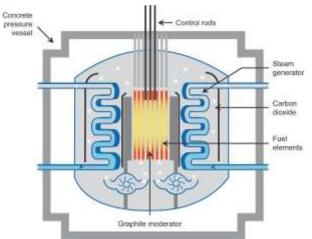


12/14/2016

### Nuclear Reactor History and Generations

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

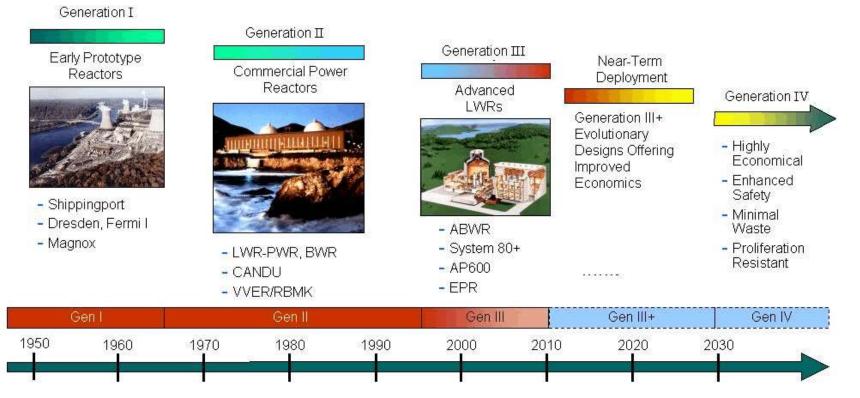

- Generation II: class of commercial reactors built up to the end of the 1990s
- Generation III: development of Gen. II designs, improved fuel technology, superior thermal efficiency, passive safety systems, and standardized design
- Generation IV: nuclear reactor designs currently being researched, not expected to be available for commercial construction before 2030



### Gen. II Water Moderated Reactor Types

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems



Pressurized Water Reactor (PWR)

Cooled and moderated by high-pressure liquid water, primary and secondary loops



**Boiling Water Reactor (BWR)** 

Higher thermal efficiency, simpler design (single loop), potentially more stable and safe (?)



Pressurized Heavy Water Reactor (PHWR)

Heavy-water-cooled and -moderated pressurized-water reactors, fuel in tubes, efficient but expensive




High Power Channel Reactor (RBMK)

Water cooled with a graphite moderator, fuel in tubes, cheap, large and powerful reactor but unstable



### Common Light Water Moderated Reactors

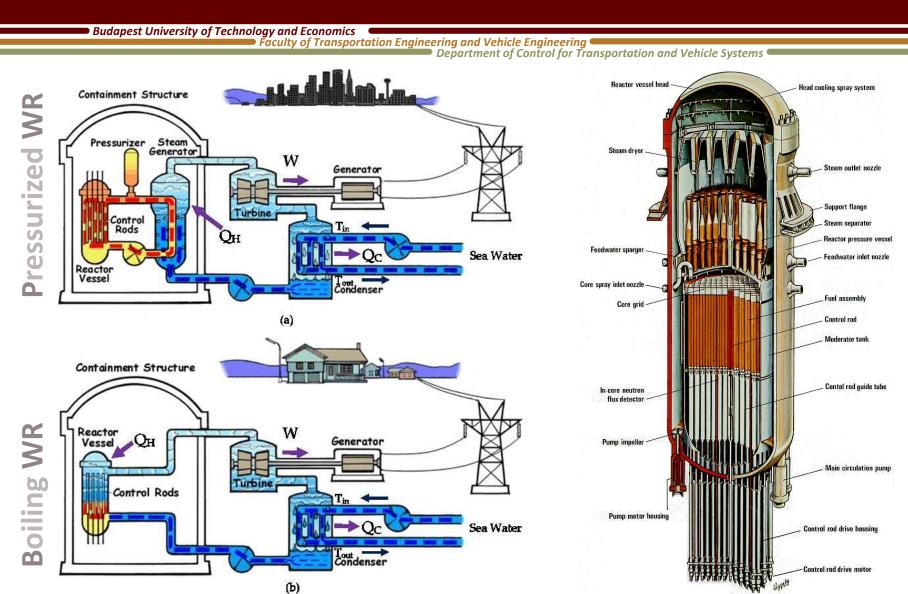


2016.12.14.

**Nuclear Safety Basics** 

12

### Overview of a PWR nuclear power plant

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

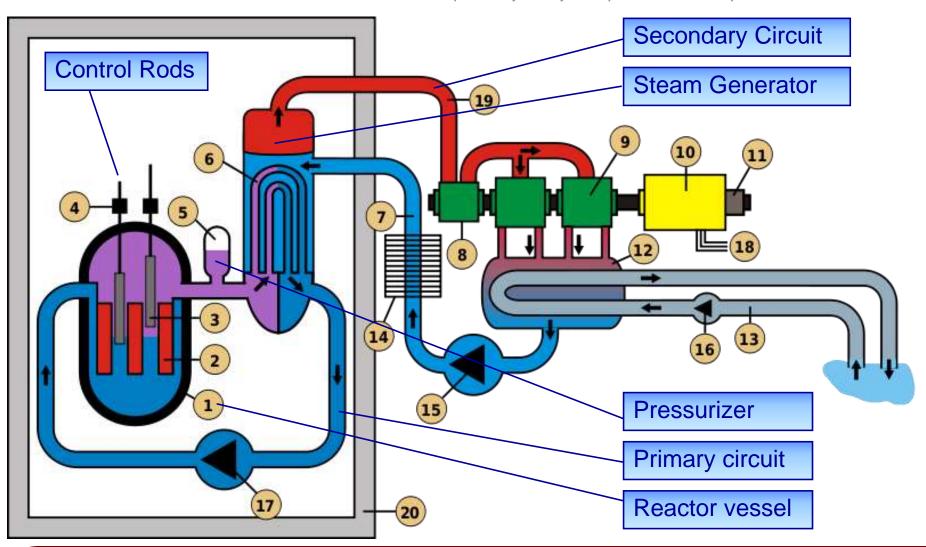

# Risk of Nuclear Installations

Using the Terms of the Functional Safety Concept



## Functional Safety Concept: Risk

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

- Risk based approach for determining the target failure measure
  - Risk is a measure of the probability and consequence of a specified hazardous event occurring
  - There is no such thing as "Zero Risk"
- A safety-related system both
  - implements the required safety functions necessary to
    - achieve a safe state for the EUC or
    - to maintain a safe state for the EUC
  - is intended to achieve the necessary safety integrity for the required safety functions




### Consequence: Effects of Ionizing Radiation

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering


Department of Control for Transportation and Vehicle Systems

#### **Deterministic effect**

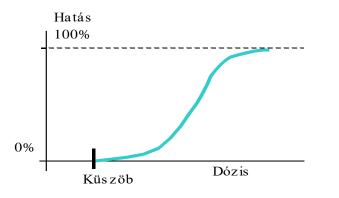

- Natural radiation
  - Internal radiation: <sup>40</sup>K
  - External radiation
    - Background radiation
- TENORM
  - artificially increased background radiation

#### **Stochastic effect**

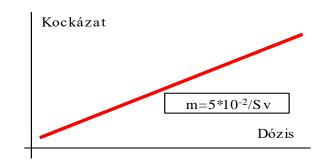

- Artificial radiation
  - Medical diagnosis and treatment
  - Industrial radiation sources
  - Nuclear tests
  - Nuclear waste



### The Risk Assessment Framework

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

- The three main stages of Risk Assessment are:
  - 1. Establish the tolerable risk criteria with respect to
    - the frequency (or probability) of the hazardous event
    - and its specific consequences
  - 2. Assess the risks associated with the equipment under control
  - 3. Determine the necessary risk reduction needed to meet the risk acceptance criteria
    - this will determine the Safety Integrity Level of the safetyrelated systems and external risk reduction facilities




### Example Risk Bands for Tolerability of Hazards

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering 🥌

Department of Control for Transportation and Vehicle Systems

18

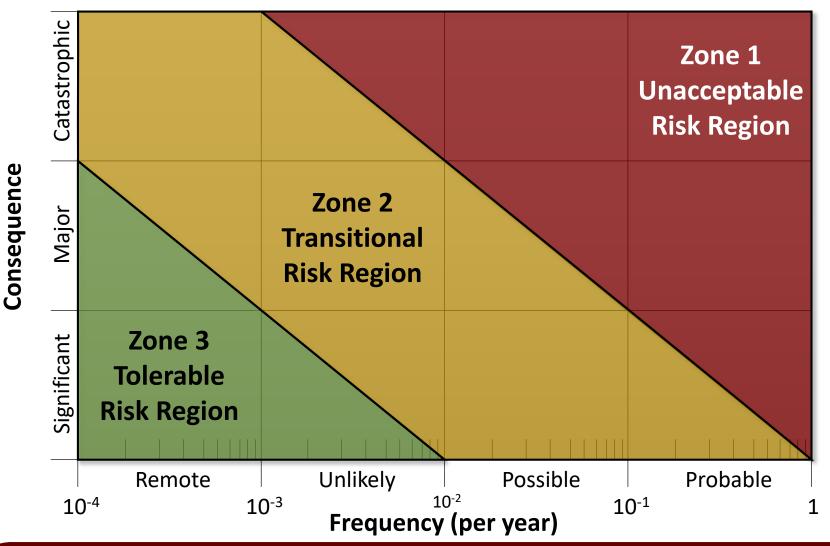

2016.12.14.

### How would Risk Bands look like in Nuclear?

Budapest University of Technology and Economics

↑

Faculty of Transportation Engineering and Vehicle Engineering


Severity of consequence	Design Basis Accidents	Beyond Design Basis Accidents	Severe Accidents	
	Anticipated Operational Occurrences	Design Basis Accidents	Beyond Design Basis Accidents	
	Normal Operation	Anticipated Operational Occurrences	Design Basis Accidents	
-	Probability of occurrence (in decreasing order)10-4			
2016.12.14. Nuclear Safety Basics				

### The Basic Principle of Frequency versus Consequences

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

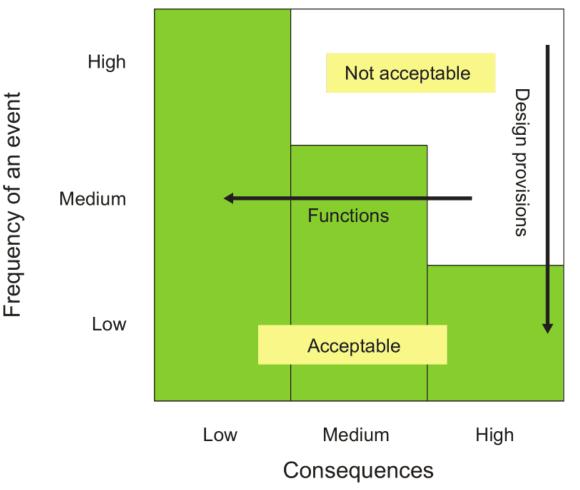

Design provisions are implemented primarily to decrease the probability of an accident, and functions are implemented to make the consequences acceptable with regard to its probability.


From IAEA Specific Safety Guide No. SSG-30: Safety Classification of Structures, Systems and Components in Nuclear Power Plants



### Thus, Risk Bands look in Nuclear like this:

Budapest University of Technology and Economics 🛛 🖛

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

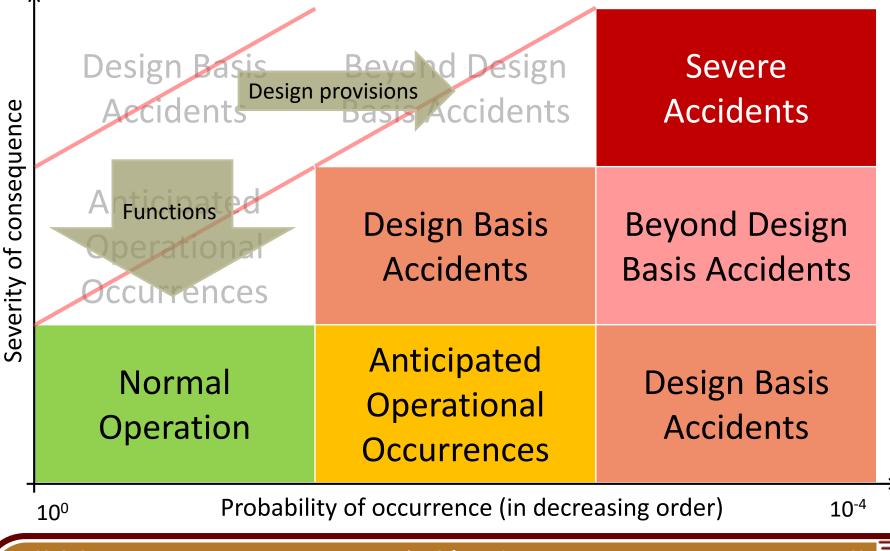

2016.12.14.

### Operational States and Transients of NPPs

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

- Normal Operational State
  - most probable, most frequent state
- Operational Transients aka.

**Anticipated Operational Occurrences (AOO)** 


- highly probable operational occurrences, having a minor effect
- good chance of multiple AOOs during operational life-time
- Design Basis Accidents
  - improbable accidents, these are included in the Design Basis
- Beyond Design Basis Accidents Severe Accidents
  - extremely improbable accidents
  - the Design Basis of most existing units does not include BDBAs
  - this is changing, many former BDBAs became DBAs in the case of Generation III and Generation IV nuclear units



### Classification of Events & Operating Conditions

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

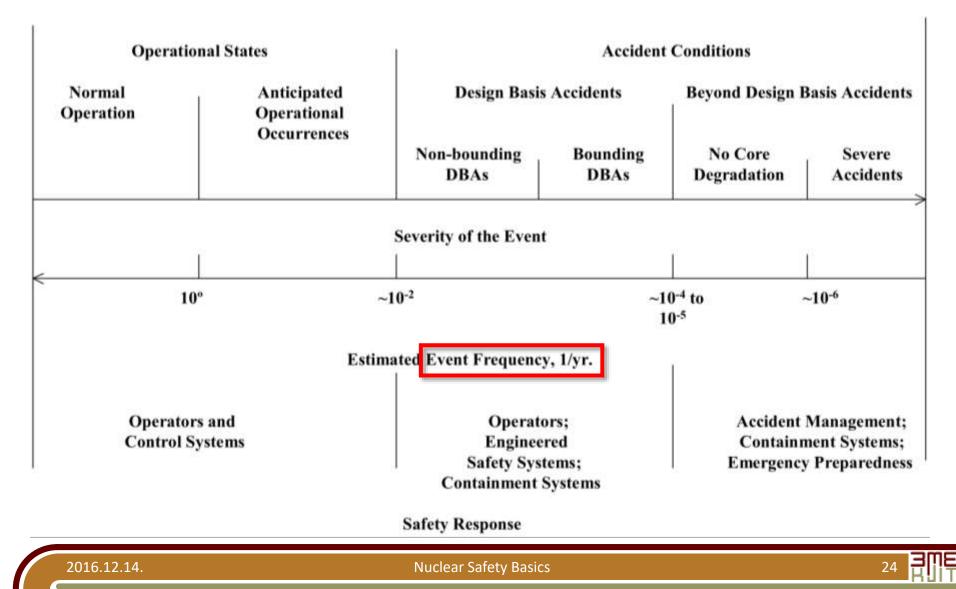


### Definition of Safety

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

• Central concepts: Hazard, risk and safety

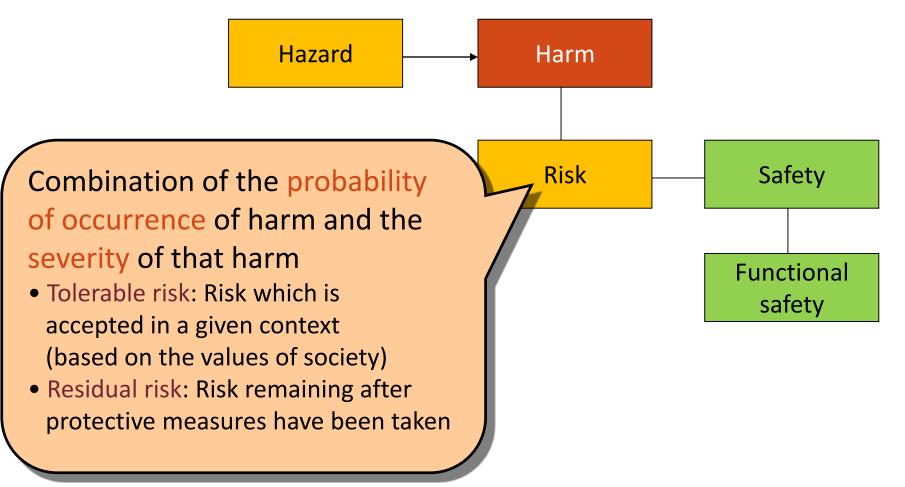

## Postulated Initiating Events

Budapest University of Technology and Economics
Faculty of Transportation Engineering and Vehicle Engineering
Department of Control for Transportation and Vehicle Systems

- A postulated initiating event (PIE) is an "identified event that leads to an anticipated operational occurrence (AOO) or accident condition and its consequential failure effects."
  - All safety analysis, deterministic or probabilistic, begins with definition of a set of PIEs
- PIEs may be defined from various sources:
  - Formal analytical techniques, such as
    - Failure modes and effects analysis (FMEA), or
    - Hazards and operability analysis (HAZOP)
  - PIE lists developed for other, similar plants
  - Operating experience with other plants
  - Engineering judgement

## Classification of PIEs

Budapest University of Technology and Economics
 Faculty of Transportation Engineering and Vehicle Engineering

#### Department of Control for Transportation and Vehicle Systems

### According to origin:

- Internal events
  - are those PIEs that arise
    - due to failures of systems, structures, components within the plant, or
    - due to internal human error, and
  - provide a challenge to internal safety systems.
- External events
  - are those PIEs that arise from
    - conditions external to the plant, such as natural phenomena, or
    - off-site human-caused events, and
  - provide a challenge to safety equipment and/or to plant integrity.



## The Design Basis

Budapest University of Technology and Economics
 Faculty of Transportation Engineering and Vehicle Engineering
 Department of Control for Transportation and Vehicle Systems

- The design basis specifies the necessary capabilities of the plant to cope with a specified range of operational states and design basis accidents within the defined radiological protection requirements
- The design basis includes
  - the specification for normal operation,
  - plant states created by the PIEs,
  - the safety classification,
  - important assumptions and,
  - in some cases, the particular methods of analysis.



### Identification of Internal Initiating Events

Budapest University of Technology and Economics
 Faculty of Transportation Engineering and Vehicle Engineering

- Proper operation depends on maintaining the correct balance between
  - power production in the core
  - transport of energy in the reactor cooling system (RCS)
  - removal of energy from the RCS, and
  - production of electrical energy
- Thus, PIE categories may include:
  - change in heat removal from the RCS
  - change in coolant flow rate
  - change in reactor coolant inventory, including pipe breaks
  - reactivity and power distribution anomalies
  - release of radioactive material from a component or system



### Identification of Internal Initiating Events

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

- Consider failures (including partial failures or malfunctions) of safety systems and components, as well as non-safety systems and components that impact safety function
- Consider consequences of human error:
  - Faulty maintenance
  - Incorrect settings or calibrations
  - Incorrect operator actions
- Include fires, explosions, floods which could cause failure of safety equipment
- Some events from outside the plant may be analyzed as internal events because of the nature of their impact
  - Loss of off-site power
  - Loss of component cooling water

### Identification of External Initiating Events

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

External events can lead to an internal initiating event and failure of safety systems that provide protection.

- Naturally occurring events:
  - Earthquakes
  - Fires
  - Floods and other high water events
  - Volcanic eruptions
  - Extremes of temperature, rainfall, snowfall, wind velocity
- Human-caused events:
  - Aircraft crashes
  - External fires, explosions, and hazardous material releases

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

# Nuclear Accidents

The Three Most Prominent Accidents in the History of Nuclear Power Generation, and Lessons Learned



### Main Types of Nuclear Reactor Accidents

Budapest University of Technology and Economics
 Faculty of Transportation Engineering and Vehicle Engineering


- Accident initiated by sudden reactivity increase (e.g. control rod ejection) that causes reactor runaway
  - RIA Reactivity Initiated Accident
  - the nuclear chain reaction becomes uncontrollable
    - prompt supercritical reactor
- Accident initiated by insufficient cooling (e.g. due to loss of coolant)
  - the efficiency of heat removal from the core drops
  - the reactor core cooling is lost
  - that can cause damage to the fuel cladding
    - LOCA Loss of Coolant Accident
    - LOFA Loss of Flow Accident
    - LOHA Loss of Heat Sink Accident



### Reactivity Initiated Accident

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems



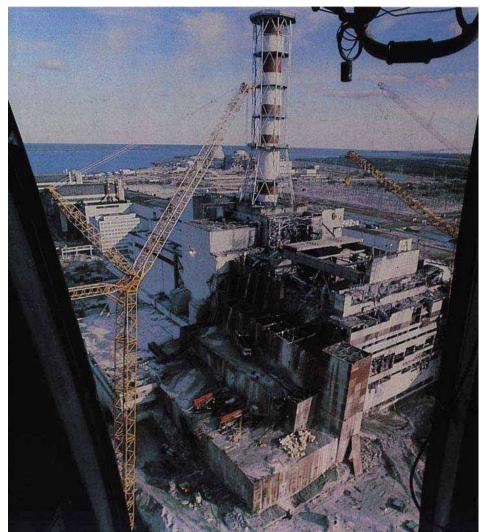





#### 2016.12.14.




### Loss of Coolant Accident – LB LOCA

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering


Department of Control for Transportation and Vehicle Systems

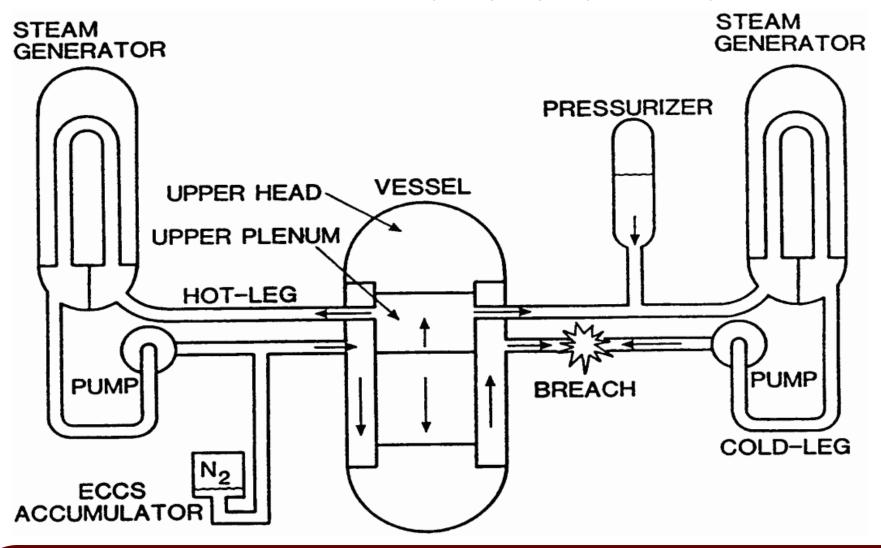

2016.12.14.



### International Nuclear Event Scale (INES)

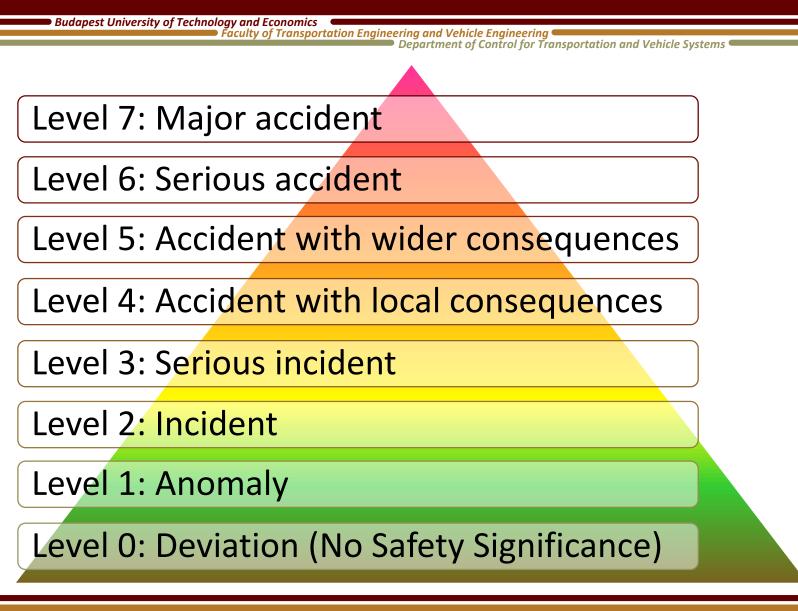


2016.12.14.



### Details and Examples of the INES Scale

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering


Department of Control for Transportation and Vehicle Systems

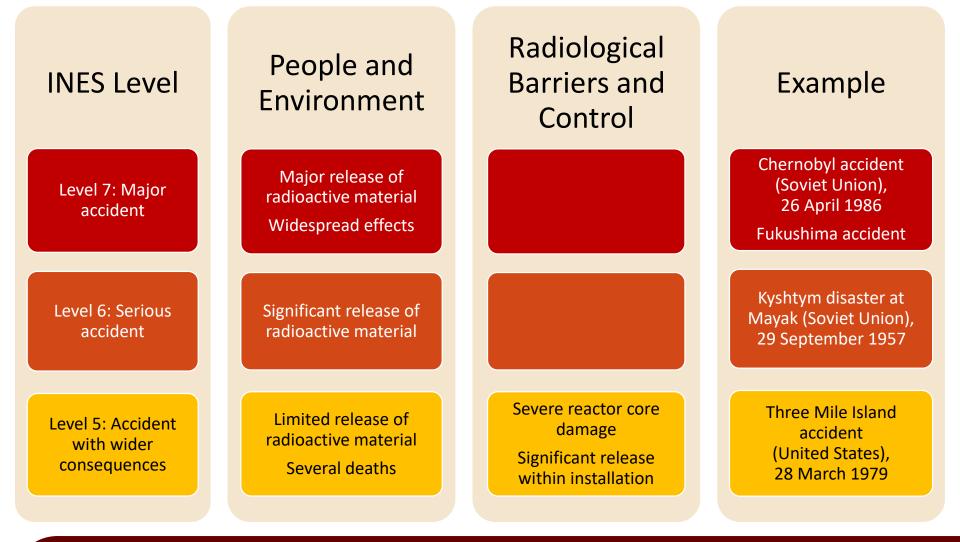

2016.12.14.



Faculty of Transportation Engineering and Vehicle Engineering
Department of Control for Transportation and Vehicle Systems

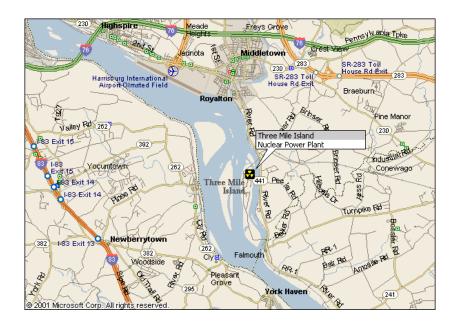




# Three Mile Island Accident

- In 1979 at Three Mile Island nuclear power plant in USA a cooling malfunction caused part of the core to melt in the #2 reactor. The TMI-2 reactor was destroyed.
- Some radioactive gas was released a couple of days after the accident, but not enough to cause any dose above background levels to local residents.
- There were no injuries or adverse health effects from the Three Mile Island accident.

## Three Mile Island Accident

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

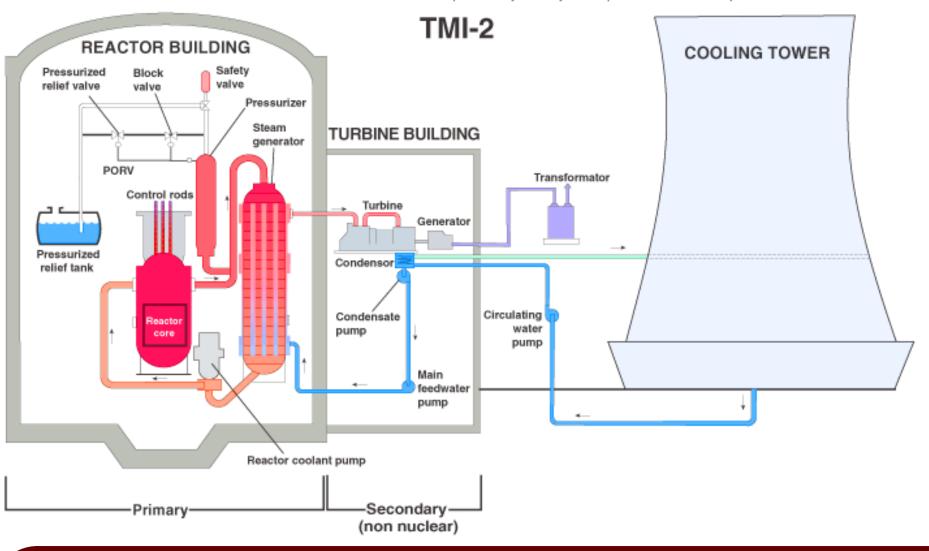

2016.12.14.



# Three Mile Island Accident

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

- In 1979 at Three Mile Island nuclear power plant in USA a cooling malfunction caused part of the core to melt in the #2 reactor:
  - A relatively minor malfunction in the secondary cooling circuit caused the temperature in the primary coolant to rise.
  - This in turn caused the reactor to shut down automatically.
  - A relief valve failed to close, but instrumentation did not reveal the fact!
  - So much of the primary coolant drained away that the residual decay heat in the reactor core was not removed,
  - The core suffered severe damage as a result.
  - The operators were unable to diagnose or respond properly to the unplanned automatic shutdown of the reactor.
  - Deficient control room instrumentation and inadequate emergency response training proved to be root causes of the accident!
- Some radioactive gas was released a couple of days after the accident, but not enough to cause any dose above background levels.
- There were no injuries or adverse health effects from the TMI accident.




## Three Mile Island Accident

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering


Department of Control for Transportation and Vehicle Systems

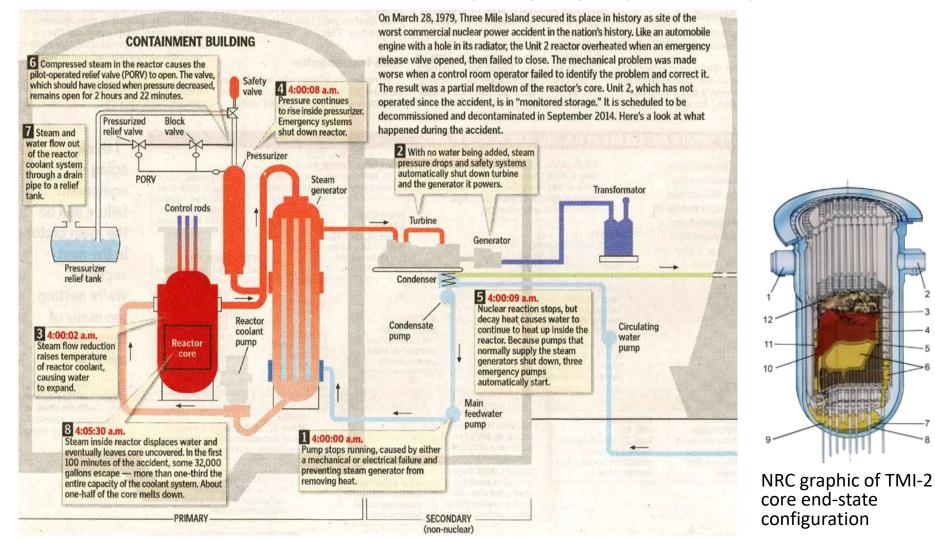


2016.12.14.

### TMI-2 reactor vessel after the accident

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

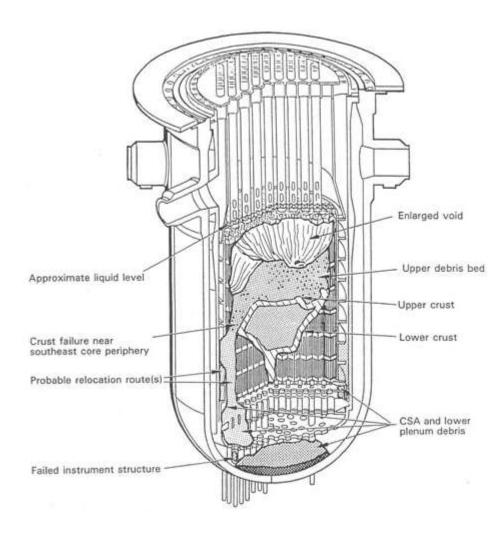



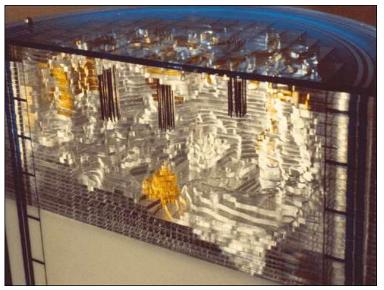

### 2016.12.14.



Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems







# Chernobyl Accident

- The Chernobyl accident in 1986 was the result of a flawed reactor design that was operated with inadequately trained personnel.
- The resulting steam explosion and fires released at least 5% of the radioactive reactor core into the atmosphere and downwind – some 5200 PBq (I-131 eq).
- Two Chernobyl plant workers died on the night of the accident, and a further 28 people died within a few weeks as a result of acute radiation poisoning.

# Chernobyl Accident






### Schematic diagram of the RBMK reactor

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

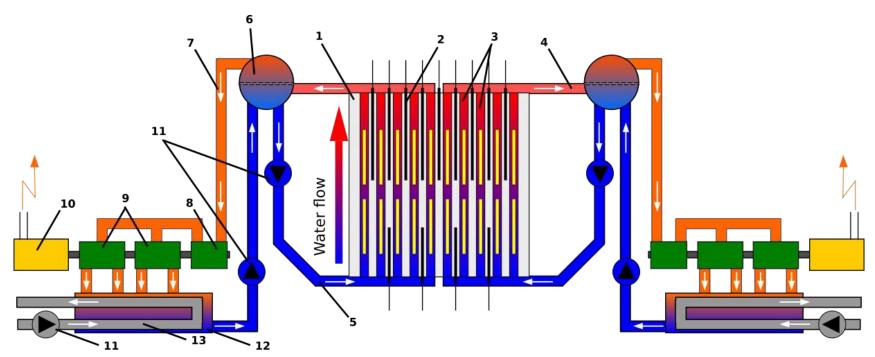

#### Legend :

- 1. Graphite moderated reactor core
- 2. Control rods
- 3. Pressure channels with fuel rods
- Water/steam mixture
- 5. Water
- 6. Water/steam separator
- 7. Steam inlet

- 8. High-pressure steam turbine
- Low-pressure steam turbine
- 10. Generator
- 11. Pump
- 12. Steam condenser
- 13. Cooling water (from river, sea, etc.)


## **RBMK Reactor Hall**

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems





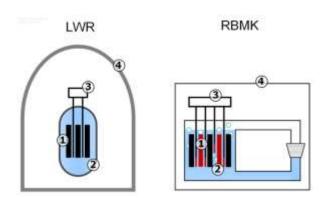

Major differences between the Chernobyl RBMK and the LWR:1. The use of a graphite moderator in a water cooled reactor.2. A positive steam void coefficient that made the power excursion possible, which blew the reactor vessel.

 The control rods were very slow, taking 18-20 seconds to be deployed. The control rods had graphite tips that moderated, and thus increased the fission rate in the beginning of the rod insertion.
 No reinforced containment building.

#### 12/14/2016



# Chernobyl Accident

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems

- The Chernobyl accident in 1986 was the result of a flawed reactor design that was operated with inadequately trained personnel
  - The crew wanted to perform a test to determine how long turbines would spin and supply power to the main circulating pumps following a loss of main electrical power supply
  - A series of operator actions, including the disabling of automatic shutdown mechanisms, preceded the attempted test
  - By the time that the operator moved to shut down the reactor, the reactor was in an extremely unstable condition
  - A peculiarity of the design of the control rods caused a dramatic power surge as they were inserted into the reactor
    - The RBMK reactor has a positive void coefficient due to deficiencies in the design
  - The interaction of very hot fuel with the cooling water led to fuel fragmentation
  - Intense steam generation then spread throughout the whole core causing a steam explosion and releasing fission products to the atmosphere
  - A second explosion threw out fragments from the fuel channels and hot graphite
- The resulting steam explosion and fires released at least 5% of the radioactive reactor core into the atmosphere
- Two Chernobyl plant workers died on the night of the accident, and a further 28 people died within a few weeks as a result of acute radiation poisoning



# **Operating RBMK plants**

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

- In 2006, Rosatom said it was considering lifetime extensions and uprating of its 11 operating RBMK reactors.
  - Following significant design modifications made after the Chernobyl accident, and extensive refurbishment including replacement of fuel channels, a 45-year lifetime is seen as realistic.
  - In 2005, they provided 48% of Russia's nuclear-generated electricity. The R&D Institute of Power Engineering is preparing plans for 5% uprating of them.
- The 'operating until' dates are the scheduled shutdown for these plants, with 15-year lifetime extensions in some cases.
  - Lithuania, on the other hand, closed Ignalina 1 &2 early as a condition for entry into the European Union.
- Russia's long-term plans had earlier included the possibility of replacing the Leningrad units, at the end of their extended service life, by new MKER-1000 units.
  - These are a modification of the RBMK design. The main differences are in the spacing of the graphite lattice in the core and the incorporation of passive safety systems.

Location	Unit	First power	Unit net capacity (MWe)	Status
Lithuania				
Ignalina	1	1983	1185 (originally 1300)	Closed 12/2004
	2	1987	1185 (originally 1300)	Closed 12/2009
Russia				
Kursk	1	1976	925	Operating until 2021
	2	1979	925	Operating until 2024
	3	1984	925	Operating until 2029
	4	1986	925	Operating until 2030
	5	-		Construction suspended
Leningrad	1	1973	925	Operating until 2019
	2	1975	925	Operating until 2021
	3	1979	925	Operating until 2025
	4	1981	925	Operating until 2026
Smolensk	1	1983	925	Operating until 2028
	2	1985	925	Operating until 2030
	3	1990	925	Operating until 2034
Ukraine				
Chernobyl	1	1977	925	Closed 1996
	2	1978	925	Closed 1991
	3	1981	925	Closed 2000
	4	1983	925	Reactor destroyed 1986
	5	-	925	Construction cancelled
	6	-	925	Construction cancelled

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems





# Fukushima Accident

- Following a major earthquake, a 15-metre tsunami disabled the power supply and cooling of three Fukushima Daiichi reactors, causing a nuclear accident on 11 March 2011. All three cores largely melted in the first three days.
- The accident was rated 7 on the INES scale, due to high radioactive releases over days 4 to 6, eventually a total of some 940 PBq (I-131 eq).
- Four reactors were written off due to damage in the accident 2719 MWe net.

# Fukushima Accident

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering Department of Control for Transportation and Vehicle Systems


- Following a major earthquake, a 15-metre tsunami disabled the power supply and cooling of three Fukushima Daiichi reactors, causing a nuclear accident on 11 March 2011
  - The reactors proved robust seismically, but vulnerable to the tsunami
  - This disabled 12 of 13 back-up generators on site and also the heat exchangers for dumping reactor waste heat and decay heat to the sea
  - The three units lost the ability to maintain proper reactor cooling and water circulation functions, all three cores largely melted in the first three days
- Rated 7 on the INES scale, due to high radioactive releases over days 4 to 6
- After two weeks the three reactors (units 1-3) were stable with water addition but no proper heat sink for removal of decay heat from fuel
- By July they were being cooled with recycled water from the new treatment plant, and official 'cold shutdown condition' was announced in mid-December
- Apart from cooling, the basic ongoing task was to prevent release of radioactive materials, particularly in contaminated water leaked from the three units
- There have been no fatalities linked to short term overexposure to radiation in the nuclear accident, but over 100,000 people had to be evacuated from their homes



### General Electric BWR Mark I containment

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

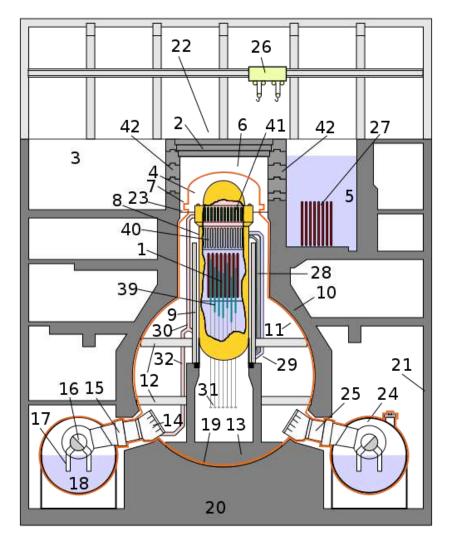

Cross-section sketch of a typical BWR Mark I containment, as used in Units 1 to 5.

The reactor core (1) consists of fuel rods and moderator rods (39) which are moved in and out by the device (31). Around the pressure vessel (8), there is an outer containment (19) which is closed by a concrete plug (2). When fuel rods are moved in or out, the crane (26) will move this plug to the pool for facilities (3). Steam from the dry well (11) can move to the wet well (24) through jet nozzles (14) to condense there (18). In the spent fuel pool (5), the used fuel rods (27) are stored.




# Fukushima Daiichi nuclear disaster


Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering


Department of Control for Transportation and Vehicle Systems

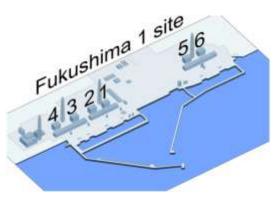


Fukushima Daiichi I nuclear power plant site close-up.



The height of the tsunami that struck the station approximately 50 minutes after the earthquake.

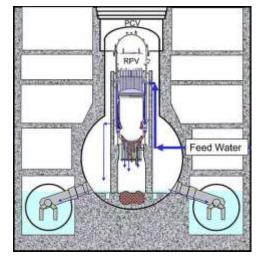

The suspected location of molten fuel inside Unit 1, according to the MAAP report from November 2011. Most of the fuel from Unit 1 is assumed to be at the bottom of the Primary Containment Vessel (PCV), where it is estimated to be "well cooled down".

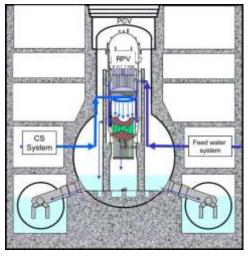

The suspected location of molten fuel inside Unit 2 and Unit 3, according to the MAAP report from November 2011. Most of the fuel from Units 2 and 3 was assumed to have remained in the Reactor Pressure Vessel (RPV).

# Fukushima Daiichi nuclear disaster





Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering





# Serious incident in the Paks Nuclear Power Plant (2003)

- In April 10, 2003 a serious incident occurred in Unit 2 of the Paks Nuclear Power Plant, and a small amount of radioactive material was released into the environment as a result.
- The incident arose from that the fuel assemblies overheated in the cleaning tank, and then cold water was poured on them, and due to this they were severely damaged.

## Literature

Budapest University of Technology and Economics Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

The following slides are based on and some images are taken from the following publications:

- Szatmáry Zoltán: Súlyos üzemzavar a paksi atomerőműben, Fizikai Szemle 2003/8. 266.o.
- Jelentés az Országos Atomenergia Bizottság Elnöke számára a Paksi Atomerőműben 2003. április 10-én bekövetkezett esemény hatósági kivizsgálásáról (Esemény azonosító: 1120), Országos Atomenergia Hivatal, 2003. május 23.
- L. Vöröss (HAEA, Hungary): Lessons learned from the INES-3 event at PAKS NPP on April 10, 2003, EUROSAFE 2003 Forum, Nuclear Expertise and the Challenge of EU Enlargement, Paris, 25 & 26 November 2003.
- Attila Aszódi, Gábor Légrádi, Ildikó Boros: Causes, course and consequences of fuel damage incident in the Paks NPP, 2003 and connecting thermal-hydraulic analyses, Nuclear Engineering and Design, Volume 240, Issue 3, March 2010, Pages 550-567, ISSN 0029-5493, http://dx.doi.org/10.1016/j.nucengdes.2009.10.008.
- Z. Hózer, et al.: Numerical analyses of an ex-core fuel incident: Results of the OECD-IAEA Paks Fuel Project, Nuclear Engineering and Design, Volume 240, Issue 3, March 2010, Pages 538-549, ISSN 0029-5493, http://dx.doi.org/10.1016/j.nucengdes.2009.09.031.

# Chronology of the main events

#### Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

Time	Occurrence					
April 10, 2003						
16:00	The cleaning of the 6 <sup>th</sup> batch (30 assemblies, just taken out of the reactor) was finished. However, the assemblies were not removed from the					
	cleaning tank, because the crane required for the lifting of the lid of the tank was still busy with other tasks.					
16:40	The AMDA was switched to «B» operating mode. Cooling of the fuel assemblies was ensured with the submersible pump circulating the water inside the service shaft.					
21:50	The counts on the Kr-85 measuring device of the AMDA system suddenly increased.					
21:53	The warning limit was reached on the noble gas detector placed on the reactor platform of Unit 2, the measured value was 1700 kBq/m <sup>3</sup> .					
22:50	The head of the Dosimetry Service evacuated the reactor hall.					
23:45	The measured value on the noble gas detector placed on the reactor platform was 26100 kBq/m <sup>3</sup> . Following the instructions of the Shift					
	Supervisor the maintenance ventilation systems of the reactor hall were started, the ventilation of the reactor hall operated with full capacity.					
April 11	l, 2003					
2:15	The hydraulic locks, which ensure the leak tight closing the lid of the cleaning tank were loosened by the technician of the FANP.					
	Simultaneously with the loosing of the lid of the cleaning tank the gamma dose rate significantly increased in the vicinity of the spent fuel pool					
	and the service shaft (6-12 mSv/h).					
12:40	The Safety Director ordered partial alerting of the Emergency Preparedness Organisation (telecommunication, radiation assessment groups).					
13:15	The Shift Supervisor initiated measures in order to decrease the release to the environment.					
April 16	5, 2003					
16:23	The lid of the cleaning tank was lifted. No increase was observed on the radiation measuring (SEJVAL) system.					
20:00	It was found during the visual observation, (using remote control camera), that the fuel elements inside the tank were significantly damaged.					
22:30	The Paks NPP declared stage "ALERT" and alerted its Emergency Preparedness Organisation.					
April 19	9, 2003					
10:00	The boric acid concentration in the spent fuel pool was increased to the value of 16 g/kg in order to ensure the appropriate sub-criticality. The					
	reliability of the cooling system of the cleaning tank was ensured by the newly installed pump provided so higher redundancy. One of the					
	pumps was sufficient for cooling while the other one served as reserve.					
April 20	), 2003					
0.00	The Cefet, Diverter to revise to d the encyclication of the Encyclement Dynamous Organization					

9:00 The Safety Director terminated the operation of the Emergency Preparedness Organisation.

12/14/2016




## What happened in the cleaning tank?

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

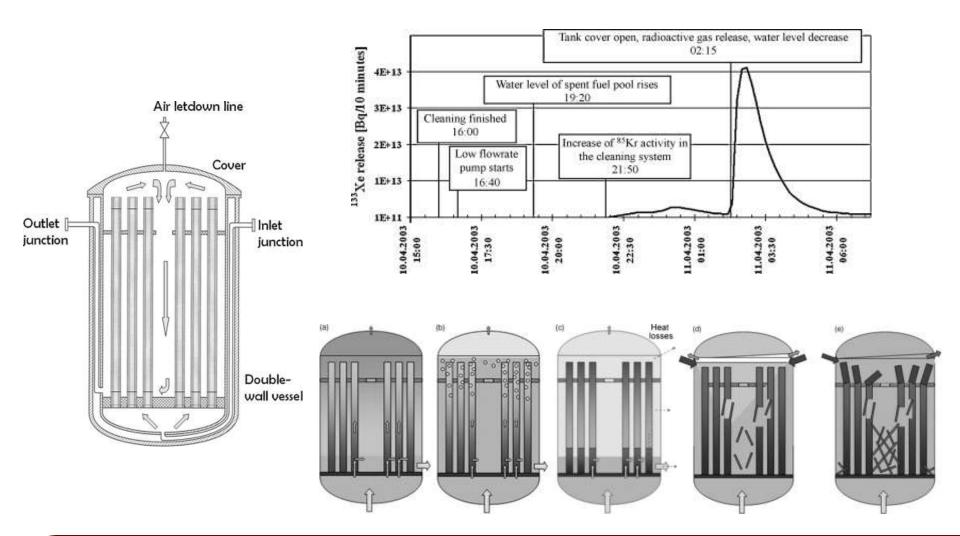






# The reasons behind the incident

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

- the outlet of the inner tank was at the bottom
- the holes in the walls of the fuel assembles were disregarded in the thermo-hydraulic design and analyzes
- the cross-section of the air vent was too small
- the sustained operation in operating status B
- the failure to open the lid early
- the imprecise fitting of the lower end of the fuel assemblies (potential)
- the complete lack of instrumentation in the tank, in particular the missing measurement of the temperature under the lid
- the lack of continuous collection of measurement data (this would have allowed earlier detection of the problems)
- the lack of evaluation of the difference in the outlet water temperature of the tank and the near-surface water temperature of the shaft
- only an imprecise measurement tool was available to notice changes in the level of the pool, and no one was monitoring it

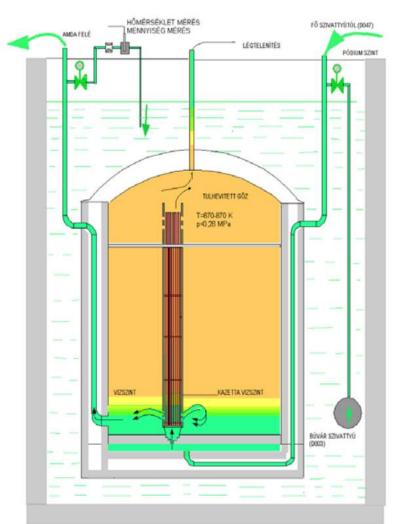


## Safety Relative to Other Energy Sources

Budapest University of Technology and Economics

Faculty of Transportation Engineering and Vehicle Engineering

Department of Control for Transportation and Vehicle Systems

### Deaths from energy-related accidents per unit of electricity

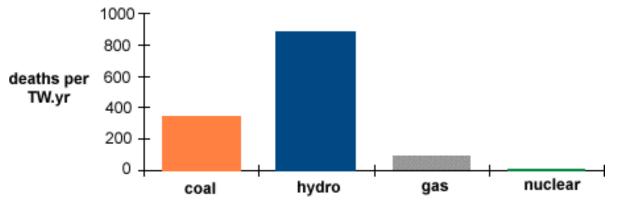

### Comparison of accident statistics in primary energy production

(Electricity generation accounts for about 40% of total primary energy)

Fuel	Immediate fatalities 1970-92	Who?	Normalized to 1/TWy* electricity
Coal	6400	workers	342
Natural gas	1200	workers & public	85
Hydro	4000	public	883
Nuclear	31	workers	8

